

SONGTAN-SI, KOREA, REPUBLIC OF (SOUTH)

TACAN or VOR/DME RWY 09L

VORTAC SOT 116.9 Chan 116	APCH CRS 088°	Rwy Idg TDZE Arpt Elev	9004 38 41
---	-------------------------	------------------------------	---------------------------------------

AL-2233 [USAF]

OSAN AB (RKSO)

▼ * When ALS inop, increase CAT A RVR to 55, vis to 1 mile, CAT B RVR to 60, vis to 1¼ miles.
** Circling not authorized from Rwy 09R CCW to 27L.




MISSED APPROACH: Climb to 4000 on SOT TACAN R-091 to FIMIP, then turn right direct CROWN and hold. Missed approach requires use of RNAV or ATC RADAR monitoring.

ATIS ★ 132.125 272.7	OSAN APP CON 127.9 234.3	OSAN TOWER 122.1 308.8	GND CON 132.45 253.7	CLNC DEL 127.3 343.0	ASR
--------------------------------	------------------------------------	----------------------------------	--------------------------------	--------------------------------	-----

When VGSI inop, procedure not authorized at night.

USAF Only: When VGSI inop, straight-in Rwy 09L authorized at night with MAJCOM A3 approval.


CAUTION: When Rwy 27R VGSI inop, circling to Rwy 27R not authorized at night.

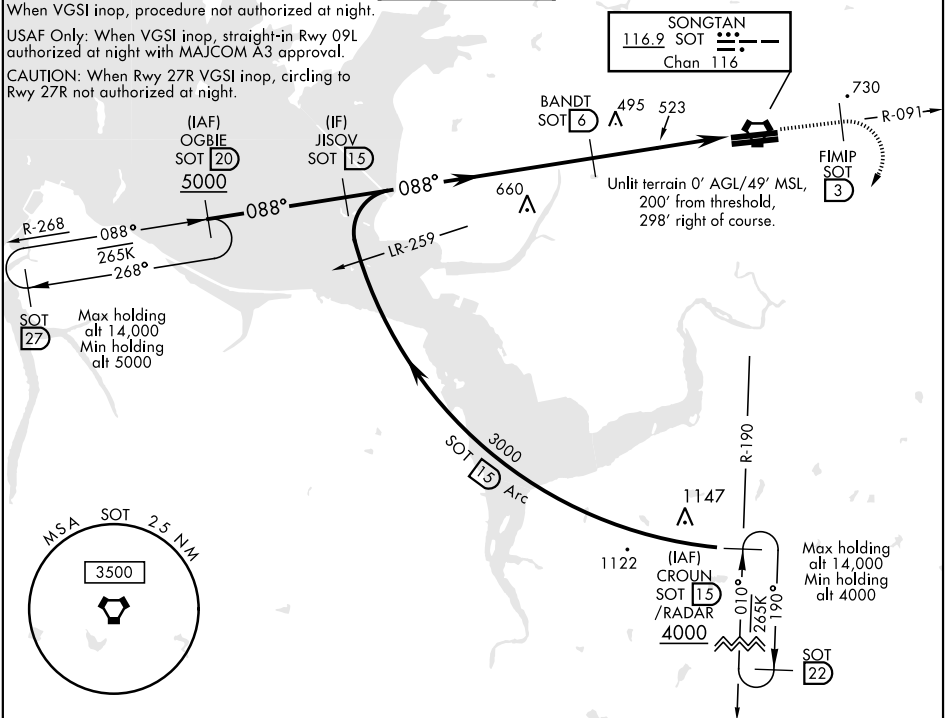


RADAR or DME REQUIRED

EMERG SAFE ALT 100 NM 6800

VDP not authorized for publication:
An obstacle penetrates the 20:1 surface for the straight-in visual area.

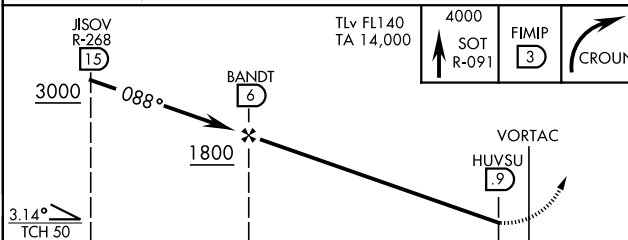

CATEGORY	A	B	C	D	E
S-09L*	780/50 742 (800-1)	780/55 742 (800-1)	780-2	742	(800-2)
CIRCLING**	780-1 739 (800-1)	780-1¼ 739 (800-1¼)	860-2½ 819 (900-2½)	1040-3	999 (1000-3)

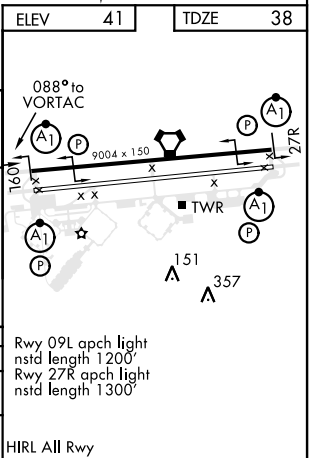

SONGTAN-SI, KOREA, REPUBLIC OF (SOUTH)

37°05'N-127°02'E

OSAN AB (RKSO)

Amdt 2 10OCT19
TERPS

TACAN or VOR/DME RWY 09L