


HI-ILS or LOC/DME RWY 3R


LOC/DME I-SAN 111.5 Chan 52	APCH CRS 032°	Rwy Idg TDZE Arprt Elev 9000 41 42	[USAF] JAL-2649 (MIL)	SEOSAN AB (RKTP)
ALSF-1 (A1)				
MISSED APPROACH: Climb to 5000 via heading 032° to I-SAN 4 DME. Then climbing left turn heading 200°, then direct to MALLI and hold.				
ATIS ★ 127.225 226.375	HAEMI APP CON 124.6 229.25	HAEMI TOWER 126.2 236.6	GND CON 275.8	ASR/PAR

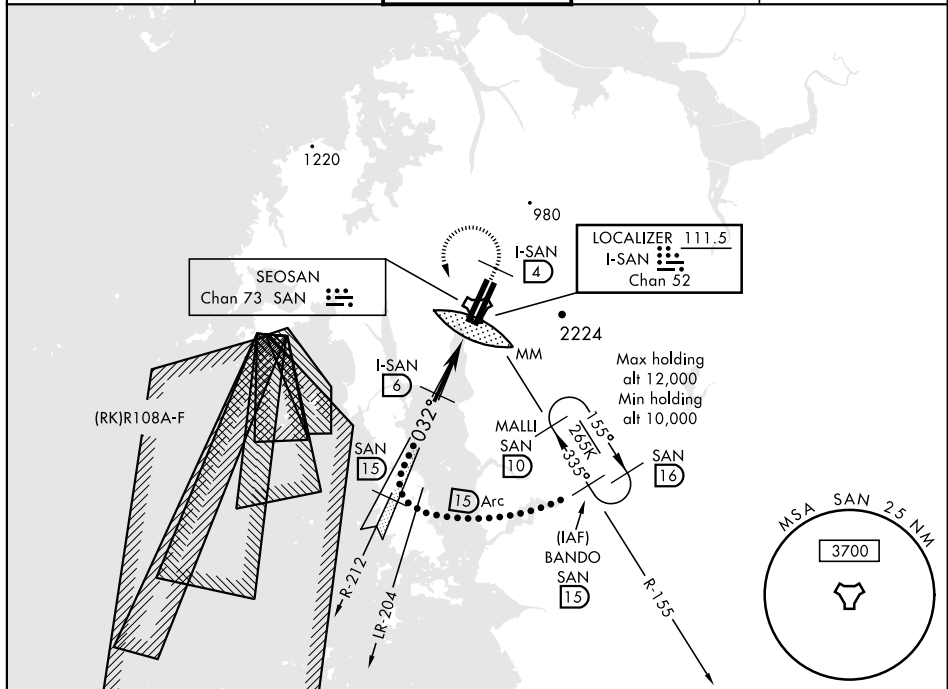

TACAN AND DME REQUIRED

EMERG SAFE ALT 100 NM 8400

5000 I-SAN 4 hdg 200°	MALLI SAN 10	Coupled apch not authorized below 300 ft. Tlv FL140 TA 14,000	R-212 SAN 15	BANDO SAN 15	10,000
TACAN	I-SAN 7	I-SAN 6	I-SAN 1	3800	2000
5. NM	5.3 NM				
GS 3.00°	TCH 46				
CATEGORY	C	D	E		
S-ILS 3R *	241/24	200 (200-½)			
S-LOC 3R **	400/40	359 (400-¾)			
CIRCLING	600-1½ 558 (600-1½)	920-2¾ 878 (900-2¾)	1840-3 1798 (1800-3)		

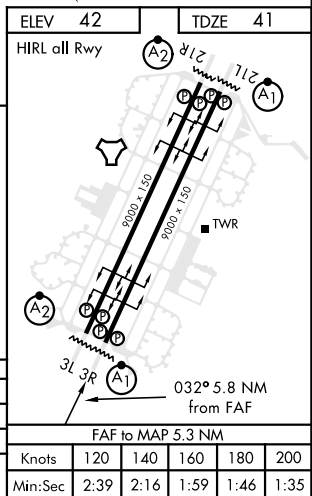

HI-ILS or LOC/DME RWY 3R